Name	oposal - Projects Funded Description	Risk Rating	Category
Public Main Carpark Ramp/Patron Access from Buses, Upgrade Main Public Stairs also required	Access from Main Carpark Buses is too steep and long for many older or disabled persons arriving on a bus	VERY HIGH	Public
	Main Pedestrian Ramp Kerbs through the centre of the site are a trip hazard		
Entry Signage	Signage currently only in written form or not to code Public Areas should be	HIGH	Public
	upgraded for visitors		
Roof Lift Lobby Doors	Heavy door to access area from lift lobby Lift Lobby pathway very steep	HIGH	Public
Hearing Loop New - Great Hall	1 area	HIGH	Public
Hearing Loop New - Information Desk Marble Foyer	1 area	HIGH	Public
Hearing Loop Upgrade - Gallery Spaces	8 Gallery spaces are non or partially compliant	HIGH	Public
Disabled Toilets Main Entry Ground	Emergency buttons installation	HIGH	Public
	Toilet pan non compliant		
	Towel rails look like grab rails		
	Coat hooks too high		1
	Door handles not to disabled code		
Basement Public Lift Buttons	Basement to first floor lift disabled button panel	HIGH	Public
Public Entry Matting	Existing mats trip hazard	HIGH	Public
External Access and Ramping Forecourt	Landscaping from main entry forecourt to the doors is mainly of red loose gravel, provide one safe continuous accessible path of travel on hard surface advised	MEDIUM	Public
Roof Grassed Area Roof Viewing Platforms Steps	Grasses areas impede wheelchair access from concrete pathways on roof Raised viewing areas have	Table	Public PA Commi ed Document
	external kerb	Inquiry B. E.S. Date / Time	timates

Organisation D.P.S.

Name	Description	Risk Rating	Category
ing Catagory OH Pussic	Existing indicator strip is painted on only and not in keeping with design of the building	Cocception Accept from Single	e Baro, xare 1 Mara Carpan Nealton Accus
Disabled Toilet Doors in Public main carpark basement	Provide a minimum 300mm internal latch side clearance at the entry doorway on the accessible toilet at the public car park on basement level	MEDIUM	Public
Installation of four kerb ramps on Parliament Drive	Kerb ramps required on Parliament drive	MEDIUM	Public

Name	Description	Risk Rating	Category	กลีเป็นอาการา
Entry to Ministerial Wing Slip Risk when Frosty	Existing granite paving when frosty is high risk slip hazard	HIGH	Private	End Ploon Inc Sallados Hearing Lenn New - Post O
Hearing Loop Upgrade - Committee Rooms	11 Rooms are non or partially compliant	HIGH	Private	Counter Greek Must Directional Signage
Hearing Loop New - Committee Rooms 1R5, 1R6, 1S5, 1S6	4 rooms	HIGH	Private	
Security Magnetometer	Wilecicial (000-	HIGH	Private	Upgrade - Pa Rooms Disabled Talk All Fublic and
	1000mm) Wheelchair users have to be searched at security		Coor Handles Its	Staff Signape
External Bollards Lifting Issue	Heavy manual lifting at corner of parliament drive Existing bollards are on a new maintenance schedule	HIGH	Private	
Captioning for live broadcasting	Captioning for live broadcasting on Website	HIGH	Public	Height Public Cerpan
Public Entrance Marble Flooring	Investigate increasing slip resistance to marble flooring	MEDIUM	Public	trandrail and carpatic see
Queens Terrace Plaque Tripping Hazard	Existing Plaque is considered a tripping hazard as it is more than 5mm off the adjacent paving	MEDIUM	Public	14 8.506 a 103
Parliament Shop Accessibility	Carpet to floors difficult to maneuver chairs, trolleys or wheelchairs Layout of sale items to be reviewed to comply	MEDIUM	Public	T beldsoon Tist?
Hearing Loop New - Security Desk Marble Foyer	1 area	MEDIUM	Public	

Name	Description	Risk Rating	Category	red -
Hearing Loop New - House of	1 area	MEDIUM	Public	ability Access
Representatives	Rating Category		Douglapion	6178
2nd Floor N/S Galleries	GM Private		Existing grapity when the trees to be	try to distantal Ming
Hearing Loop New - Post Office Counter	1 area	MEDIUM	Public	o Rick verson Intly aring Lose
Great Hall Directional Signage	Direction signage directing users to the on-grade entrances to	MEDIUM	Public	grade mutilize ons
	the upper viewing terrace of the Great Hall		SW001 N	aring Late w - Committee onts: 170, 1916.
Hearing Loop Upgrade - Party Rooms	2 Party Rooms non compliant	MEDIUM	Private	craffy grodowalter
Disabled Toilets - All Public and Staff Signage	Signage only in written form	MEDIUM	Public	
Door Handles to publically accessible areas to be disabled compliant	Door Handles to new fitouts and main public foyer and basement should comply with current BCA/Premises standards	MEDIUM		Pared Strames
Public Main Car park Emergency	Emergency phone top button at 1580mm	MEDIUM	Public	
Phone Button Height	height		Captionsys for	evil roll grinning
Public Carpark main stair handrail and	Current painted strips to car park stairs require maintenance	MEDIUM	Public	ordizate bio Evidance
carpark step upgrade			pripare designates	gniniol3 skho
14.B.504 and 14.B.505	Upgrade Balustrade to code		Fishing Plaque	egens Tenace
	Provide warning tactile ground surface indicators		hazard as Kish	briets
Disabled Toilets - , Staff	Current disabled staff toilets do comply to the current code AS1428.1 (2009) for corridor access to rooms		Private	· gons inemain Historia

Name	Description	Risk Rating	Category	smild
Entry Ceremonial Doors	Link doors in the Senate, HOR and Ministerial Wing require 12-14kg pull from wheelchair height to open A number of link doors have a flat plate on one side and handle on the other	MEDIUM	bonie amounat	HIROTOTI RESE
Linkway Doors Internal Links	Heavy Doors Linkways	MEDIUM	Private	
Doors to External Courtyards where steps occurs to the outside	Doors open outwards and directly out with a step HOR doors heavy use area and Ozzies Café	MEDIUM	Private	Parlishments Stoff Offices Accessibility
	main doors of concern	100 cm	dimus libera a W	
Existing Senate Auto Carpark Doors	Existing doors automatic door closer closes within 7 seconds	MEDIUM	Private	
	No signage on emergency intercom Significant lip on concreted access ramp		aditeliw iobinos	
	No Automatic doors to Level 1		comply in most	
House of Representatives Level 1,2 and 3 Carpark Doors	Level 1 and 2, level 3 carpark door actuators to be installed	MEDIUM	Private	
Doors to external courtyards where ramps are	Many have 620mm kerbs to courtyard or ramp leading directly to door so person in wheelchair would have trouble stabilising while opening door			
	Integrate mats			
Ceremonial entrance doors Senate and House of Representatives	Assistance panel has no signage or instructions	MEDIUM	Private	

Name	Description	Risk Rating	Category		
Staff Kitchenettes	Zip hot water system difficult to access and maybe a burn hazard General staff area tearooms should have a sink at 850mm high with taps within accessible reach	MEDIUM	Nave s fist plant one side and t	Kinon	
	Consider both accessibility and for safety for children as well		Heavy Doors D	eno)	
Parliamentary Staff Offices Accessibility	Check access to these areas as the public access these spaces	MEDIUM			
	If a small number are not then it will require management to ensure no discrimination against staff or visitors	9M secola	exop gatek(1	s/s/s	Firefug S Auto Cam Poole
	Door opening widths, corridor widths vary and door dimensions from walls do not comply in most cases				
	Generally meeting or common areas should be accessible for staff and visitors		Level 1 and 2, 1 carpark door so to be installed	savije. Sad 3 Gors	
	Ensure at least one member, one senator and one ministerial suite is accessible Members and senator suites have		etiuda or ediesi is pratiesi amen idenar, oe nodo uew ristisiesin selidas alducir	"anente	
	timber/metal threshold One office has been upgrade to be wheelchair complaint		white opening of the congresse mate has panage on instructions	2100	

	Risk Rating	Category
Existing Public Carpark has extra disabled parking for use for staff if necessary	MEDIUM	Private
Some car parking bays have a clear width of less than 3.2m and length of 5.4m		
Replicate Coir Matting in HOR as Senate Side Entry	MEDIUM	Private
2 rooms	MEDIUM	Public/ Private
Emergency buttons at incorrect heights	MEDIUM	Public/
Check buttons for disabled are in correct position		Private
Provide appropriate seating for disabled members in both Chambers	MEDIUM	Chamber
Carpet/Underlay needs to be reviewed		
Option study on access to Senate and House of Representatives required		
Entry doorways to the Senate are 750mm wide and need to be 820mm door opening width to comply		4
	has extra disabled parking for use for staff if necessary Some car parking bays have a clear width of less than 3.2m and length of 5.4m Replicate Coir Matting in HOR as Senate Side Entry 2 rooms Emergency buttons at incorrect heights Check buttons for disabled are in correct position Provide appropriate seating for disabled members in both Chambers Carpet/Underlay needs to be reviewed Option study on access to Senate and House of Representatives required Entry doorways to the Senate are 750mm wide and need to be 820mm door opening	has extra disabled parking for use for staff if necessary Some car parking bays have a clear width of less than 3.2m and length of 5.4m Replicate Coir Matting in HOR as Senate Side Entry 2 rooms MEDIUM Emergency buttons at incorrect heights Check buttons for disabled are in correct position Provide appropriate seating for disabled members in both Chambers Carpet/Underlay needs to be reviewed Option study on access to Senate and House of Representatives required Entry doorways to the Senate are 750mm wide and need to be 820mm door opening

		Private
	могазм	